

PRODUCT SUPPORT BULLETIN **No.0195**

PRODUCT: Mobile Carrier LP-15

March 6, 1997

SUBJECT: Emergency/Parking Brake System

EQUIPMENT AFFECTED: Serial Numbers: 3555 to 3560, 3564 to 3572, 3574 to 3613, 3642, 3648 to 3768, 3773 to 3787.

CLASSIFICATION: Mandatory Safety
Mandatory Repair
Optional Repair
Fix-as-fail
Information

SITUATION: The solenoid valve(s) controlling the accumulator pressure release have in some instances been sticking, causing intermittent operation of the emergency/parking brake.

SOLUTION: Change out the control solenoid valve(s). In the interim, Teledyne recommends the following:

1. Test service and emergency brake systems at the beginning of shifts and before entering ramps.
2. Chock wheels when stopped.
3. Use an escort vehicle at the lower side of vehicle when travelling on inclines.

or

Remove vehicle from service until retrofit kits are installed.

OTHER: Product Bulletin No. 196 will be sent with retrofit kit and complete instructions for installation and parts return.